

Toyostove Error Code EE30

Applies to models:
Toyostove Laser Heaters: All Models

- An EE 30 will be displayed if connector "F" (CN11) is not seated, or the green wires are not grounded.
- Turn off stove; Remove plug from 120AC outlet; Re-seat connector and tighten ground wires.
- If this fails to erase code when stove is plugged in and main switch is turned on, check resistor R9 (1800 ohms) adjacent to connector "F" (CN11) for damage.
- If resistor R9 is damaged, the main circuit board should be replaced.

WARNING

Rural Energy Enterprises, Inc. does not accept liability for the improper use of this information. Installation, service, and maintenance of heating equipment should be performed by a qualified technician. Improper installation, adjustment, alteration, service, or maintenance can cause property damage, personal injury, or loss of life.